Pond Guru Fort Myers
P.O. Box 3439,
North Fort Myers, FL 33918,
(239) 997-8872

Service Report
REP-790

Contact Details


Company	:	Livingston Lakes Condo Association
Contact	:	Sarah Mackedanz
Service Address	:	15090 Palmer Lake Circle Naples, Florida 34109
Email	:	committee@livingstonlakescondo.com

Service Details

	:	WO878
Technician Involved	:	Cole Seeley CM500495, Devin Crosbie CM23704
Scheduled Start Time	:	Oct 05, 2026 07:00 AM
Checked in with	:	Office
Equipment Used	:	Boat
Type	:	Asset Diagnostic

Attachments



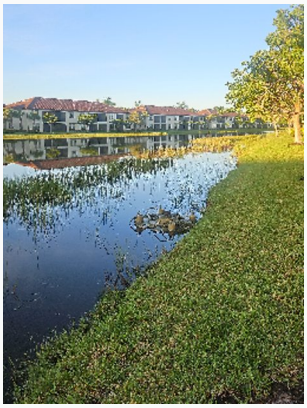

Jobsheet Details

Details/FD0085

Job Sheet Name	:	FD0085
Problem Statement	:	Fountain Diagnosis P3 not working

Comments	:	Customer complaint unit in op / verified unit does not function -check power out / bad -Check overload / tripped / reset / power out good high amp draw -check capacitor / bad, out of spec / install test cap run / bad high amp draw unit does not function - pull unit and separate motor and cable -meg wire / caution -meg ALC connector / bad -meg motor/ good / remove unit for thorough cleaning and suggested service ** need capacitor/ alc connector xl / recommend wire replaced 8/4 / timer battery x2 / oil and seals motor *** Quote will be prepared and sent.
Location of Fountains Inspected	:	Livingston P3
Fountain and Panel	:	Fountain and panel NOT functioning correctly
Fountain Incoming Voltage	:	Incoming voltage within acceptable range
Fountain Outgoing Voltage	:	Outgoing voltage NOT within acceptable range
Fountain Amps	:	Amps loaded NOT within acceptable range
Fountain GFCI	:	GFCI operating properly
Fountain Motor	:	Motor NOT operating properly
Fountain Motor Connection	:	Motor connection is dry
Fountain Motor Cable	:	Motor and cable NOT within acceptable range
Fountain Light Connector	:	Light connector is dry
Fountain Lights / Cable	:	Lights and cable operating properly
Fountain Lights	:	Lights operating properly
Fountain Photos	:	