Pond Guru Fort Myers
P.O. Box 3439,
North Fort Myers, FL 33918,
(239) 997-8872

Service Report
REP-768


Contact Details

Company	:	Livingston Lakes Condo Association
Contact	:	Sarah Mackedanz
Service Address	:	15090 Palmer Lake Circle Naples, Florida 34109
Email	:	committee@livingstonlakescondo.com

Service Details

	:	WO850
Technician Involved	:	Cole Seeley CM500495, Devin Crosbie CM23704
Scheduled Start Time	:	Sep 28, 2026 07:00 AM
Checked in with	:	None
Equipment Used	:	None
Type	:	Asset Diagnostic

Attachments

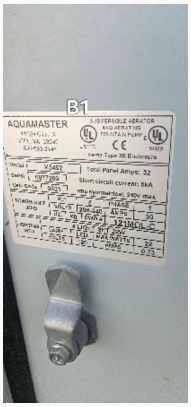



Jobsheet Details

Details/FD0081

Job Sheet Name	:	FD0081
Problem Statement	:	Fountain Diagnosis B1 not working

Comments	:	-customer states unit not functioning/ burned smell and visible damage to capacitor and wiring (see photos) -verified power in / good -unload circuit verified power out / good -check motor and cable continuity to ground / good - installed replacement cap, check run unit (amps / voltage loaded) good, No further service recommended at this time -note unit does not have gfci breaker, recommend installing proper gfci protection -left replacement cap installed AQM PN: 3001627 / DC
Location of Fountains Inspected	:	Livingston Butler Lake
Fountain and Panel	:	Fountain and panel functioning correctly
Fountain Incoming Voltage	:	Incoming voltage within acceptable range
Fountain Outgoing Voltage	:	Outgoing voltage within acceptable range
Fountain Amps	:	Amps loaded within acceptable range
Fountain GFCI	:	GFCI operating properly
Fountain Motor	:	Motor operating properly
Fountain Motor Connection	:	Motor connection is dry
Fountain Motor Cable	:	Motor and cable within acceptable range
Fountain Light Connector	:	Light connector is dry
Fountain Lights / Cable	:	Lights and cable operating properly
Fountain Lights	:	Lights operating properly
Fountain Photos	:	